



LEGEND

- TI BOUNDARY
- PROPERTY NOT OWNED BY AMETEK
- MW-1 MONITORING WELLS THAT COMPRISE THE TI BOUNDARY MONITORING WELL NETWORK.
- MW-23D SITE MONITORING WELL LOCATION
- RW-1 IRM PUMPING WELL LOCATION

- Notes:
- 1) NEW SITE WIDE BASEMAP SURVEY WAS SURVEYED BY TAYLOR WISEMAN & TAYLOR ON NOVEMBER 2011.
 - 2) TI MONITORING WELLS DISPLATED IN BLUE COMPRISE THE TI BOUNDARY MONITORING WELL NETWORK. MW-21S AND MW-21D (NEW) LIE BEYOND THE TI BOUNDARY, HOWEVER, THEY WILL BE MONITORED UNTIL MCLs ARE OBTAINED. IN ADDITION, MW-22D WILL BE MONITORED FOR 1,4-DIOXANE (PER REVISED WORK PLAN).
 - 3) THE MAIN BUILDING AND OUT STRUCTURES WERE DEMOLISHED IN 2012.

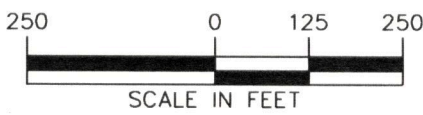

<div><div>LANGAN</div><div>Stone Manor Corporate Center, 2700 Kelly Road, Suite 200 Warrington, PA 18976 T: 215.491.6500 F: 215.491.6501 www.langan.com</div><div>Longan Engineering, Environmental, Surveying and Landscape Architecture, D.P.C. Longan Engineering and Environmental Services, Inc. Longan International LLC Collectively known as Longan</div></div>	Project AMETEK U.S. GAUGE DIVISION SELLERSVILLE BUCKS COUNTYPENNSYLVANIA	Drawing Title TI BOUNDARY MONITORING WELL NETWORK	Project No. 220051801	Drawing No. 2 Sheet 2 of 9
			Date 6/25/13	
			Scale 1"=250'	
			Drawn By MK	
			Submission Date X	

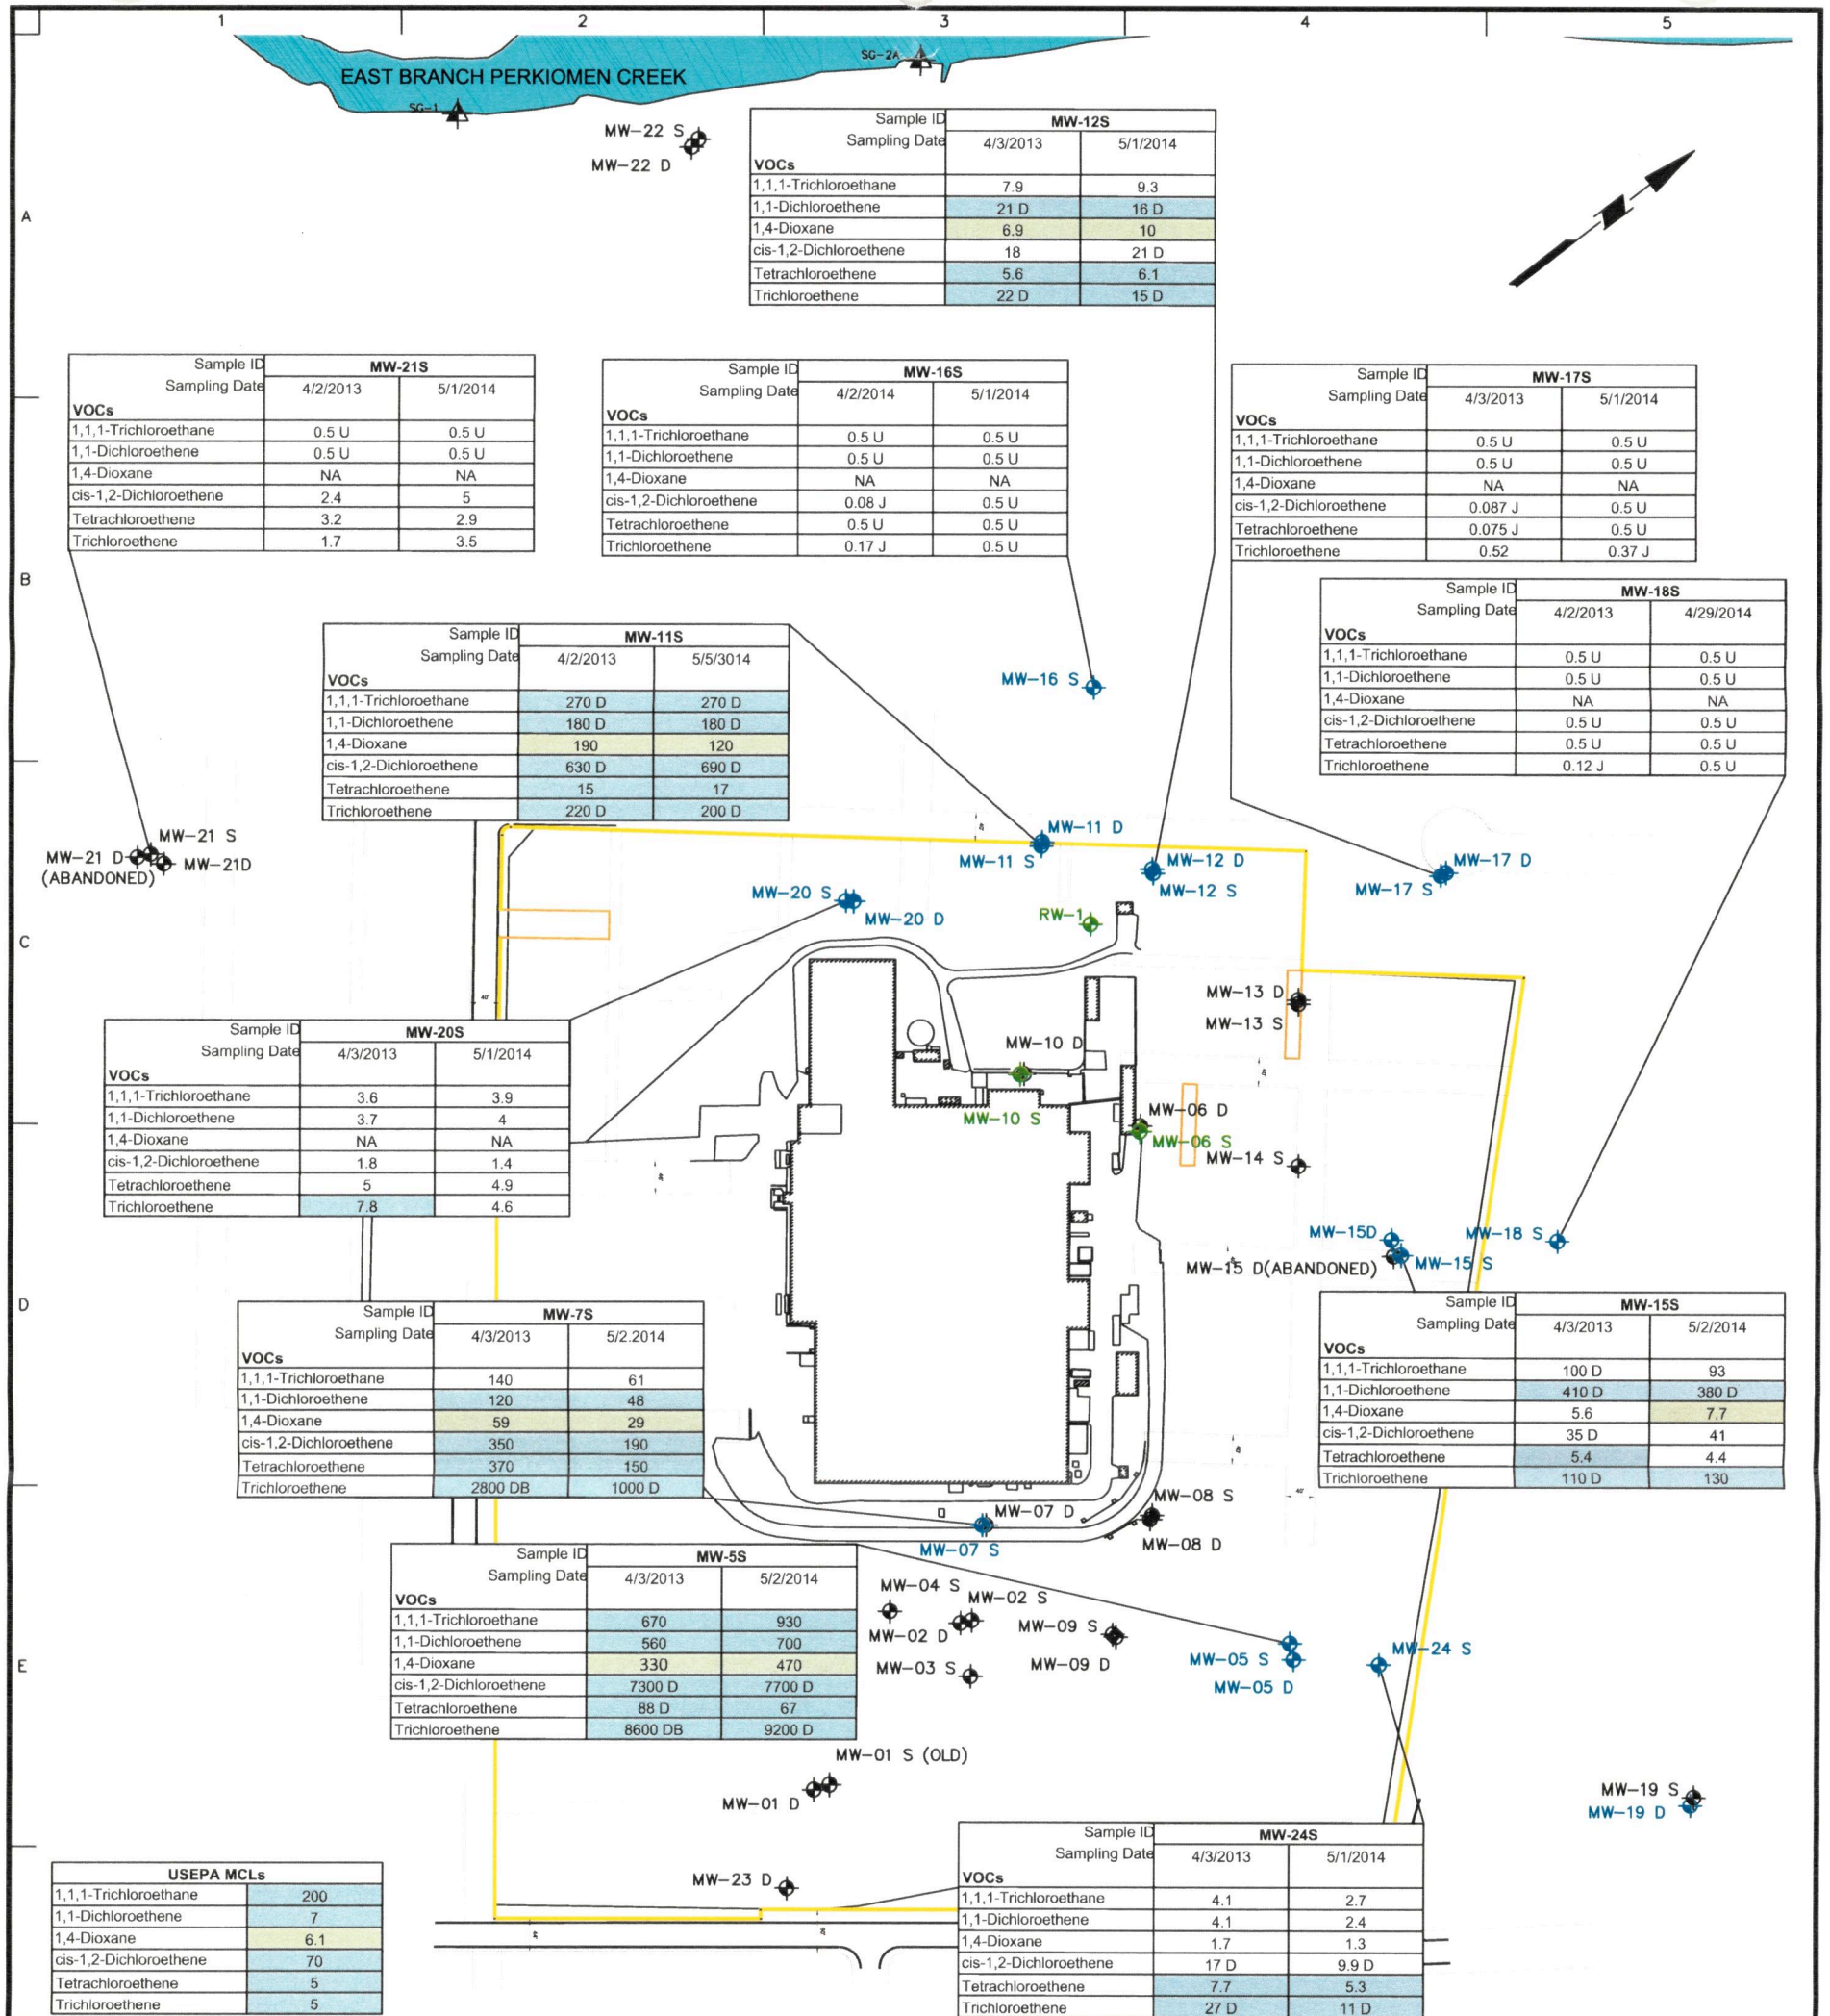

LEGEND

- TI BOUNDARY
- PROPERTY NOT OWNED BY AMETEK
- MONITORING WELLS THAT COMPRISE THE TI BOUNDARY MONITORING WELL NETWORK.
- SITE MONITORING WELL LOCATION
- IRM PUMPING WELL LOCATION

DATA QUALIFIERS:


- U = THE COMPOUND WAS ANALYZED FOR, BUT WAS NOT DETECTED
- D = THE REPORTED VALUE IS TAKEN FROM THE ANALYSIS OF A DILUTED SAMPLE.
- J = THE COMPOUND WAS POSITIVELY IDENTIFIED; THE ASSOCIATED NUMERICAL VALUE IS THE APPROXIMATE CONCENTRATION OF THE ANALYTE IN THE SAMPLE.
- B = THE COMPOUND WAS FOUND IN THE BLANK AND SAMPLE.

Notes:

- GROUNDWATER CONSTITUENTS THAT EXCEEDED USEPA'S MAXIMUM CONTAMINANT LEVELS ARE HIGHLIGHTED IN BLUE. 1,4-DIOXANE LEVELS THAT EXCEED THE USEPA'S TAPWATER RISK-BASED SCREENING LEVELS OF 6.1µg/L ARE HIGHLIGHTED IN GREEN.
- NEW SITE WIDE BASEMAP SURVEY WAS SURVEYED BY TAYLOR WISEMAN & TAYLOR ON NOVEMBER 2011.
- 10% OF LABORATORY PROVIDED ANALYTICAL DATA HAS BEEN INDEPENDENTLY VALIDATED IN ACCORDANCE WITH PROJECT PROTOCOL.
- NA = NOT ANALYZED (WELLS ANALYZED PER REVISED WORK PLAN).
- ALL CONCENTRATIONS ARE IN MICROGRAMS/LITER (µg/L).
- THE MW-6D (FORMER GROUNDWATER RECOVERY WELL) GROUNDWATER RECOVERY PUMP HAS BEEN DISCONNECTED, NO SAMPLE CAN BE COLLECTED.
- TI MONITORING WELLS DISPLAYED IN BLUE COMPRISE THE TI BOUNDARY MONITORING WELL NETWORK. MW-21S AND MW-21D (NEW) LIE BEYOND THE TI BOUNDARY, HOWEVER, THEY WILL BE MONITORED UNTIL MCLs ARE OBTAINED. IN ADDITION, MW-22D WILL BE MONITORED FOR 1,4-DIOXANE(PER REVISED WORK PLAN)
- THE MAIN BUILDING AND OUT STRUCTURES WERE DEMOLISHED IN JUNE 2012.
- PBA 10 WAS DEACTIVATED ON MARCH 23, 2007 AND REACTIVATED ON SEPT 9, 2012.

SCALE IN FEET

250 125 250

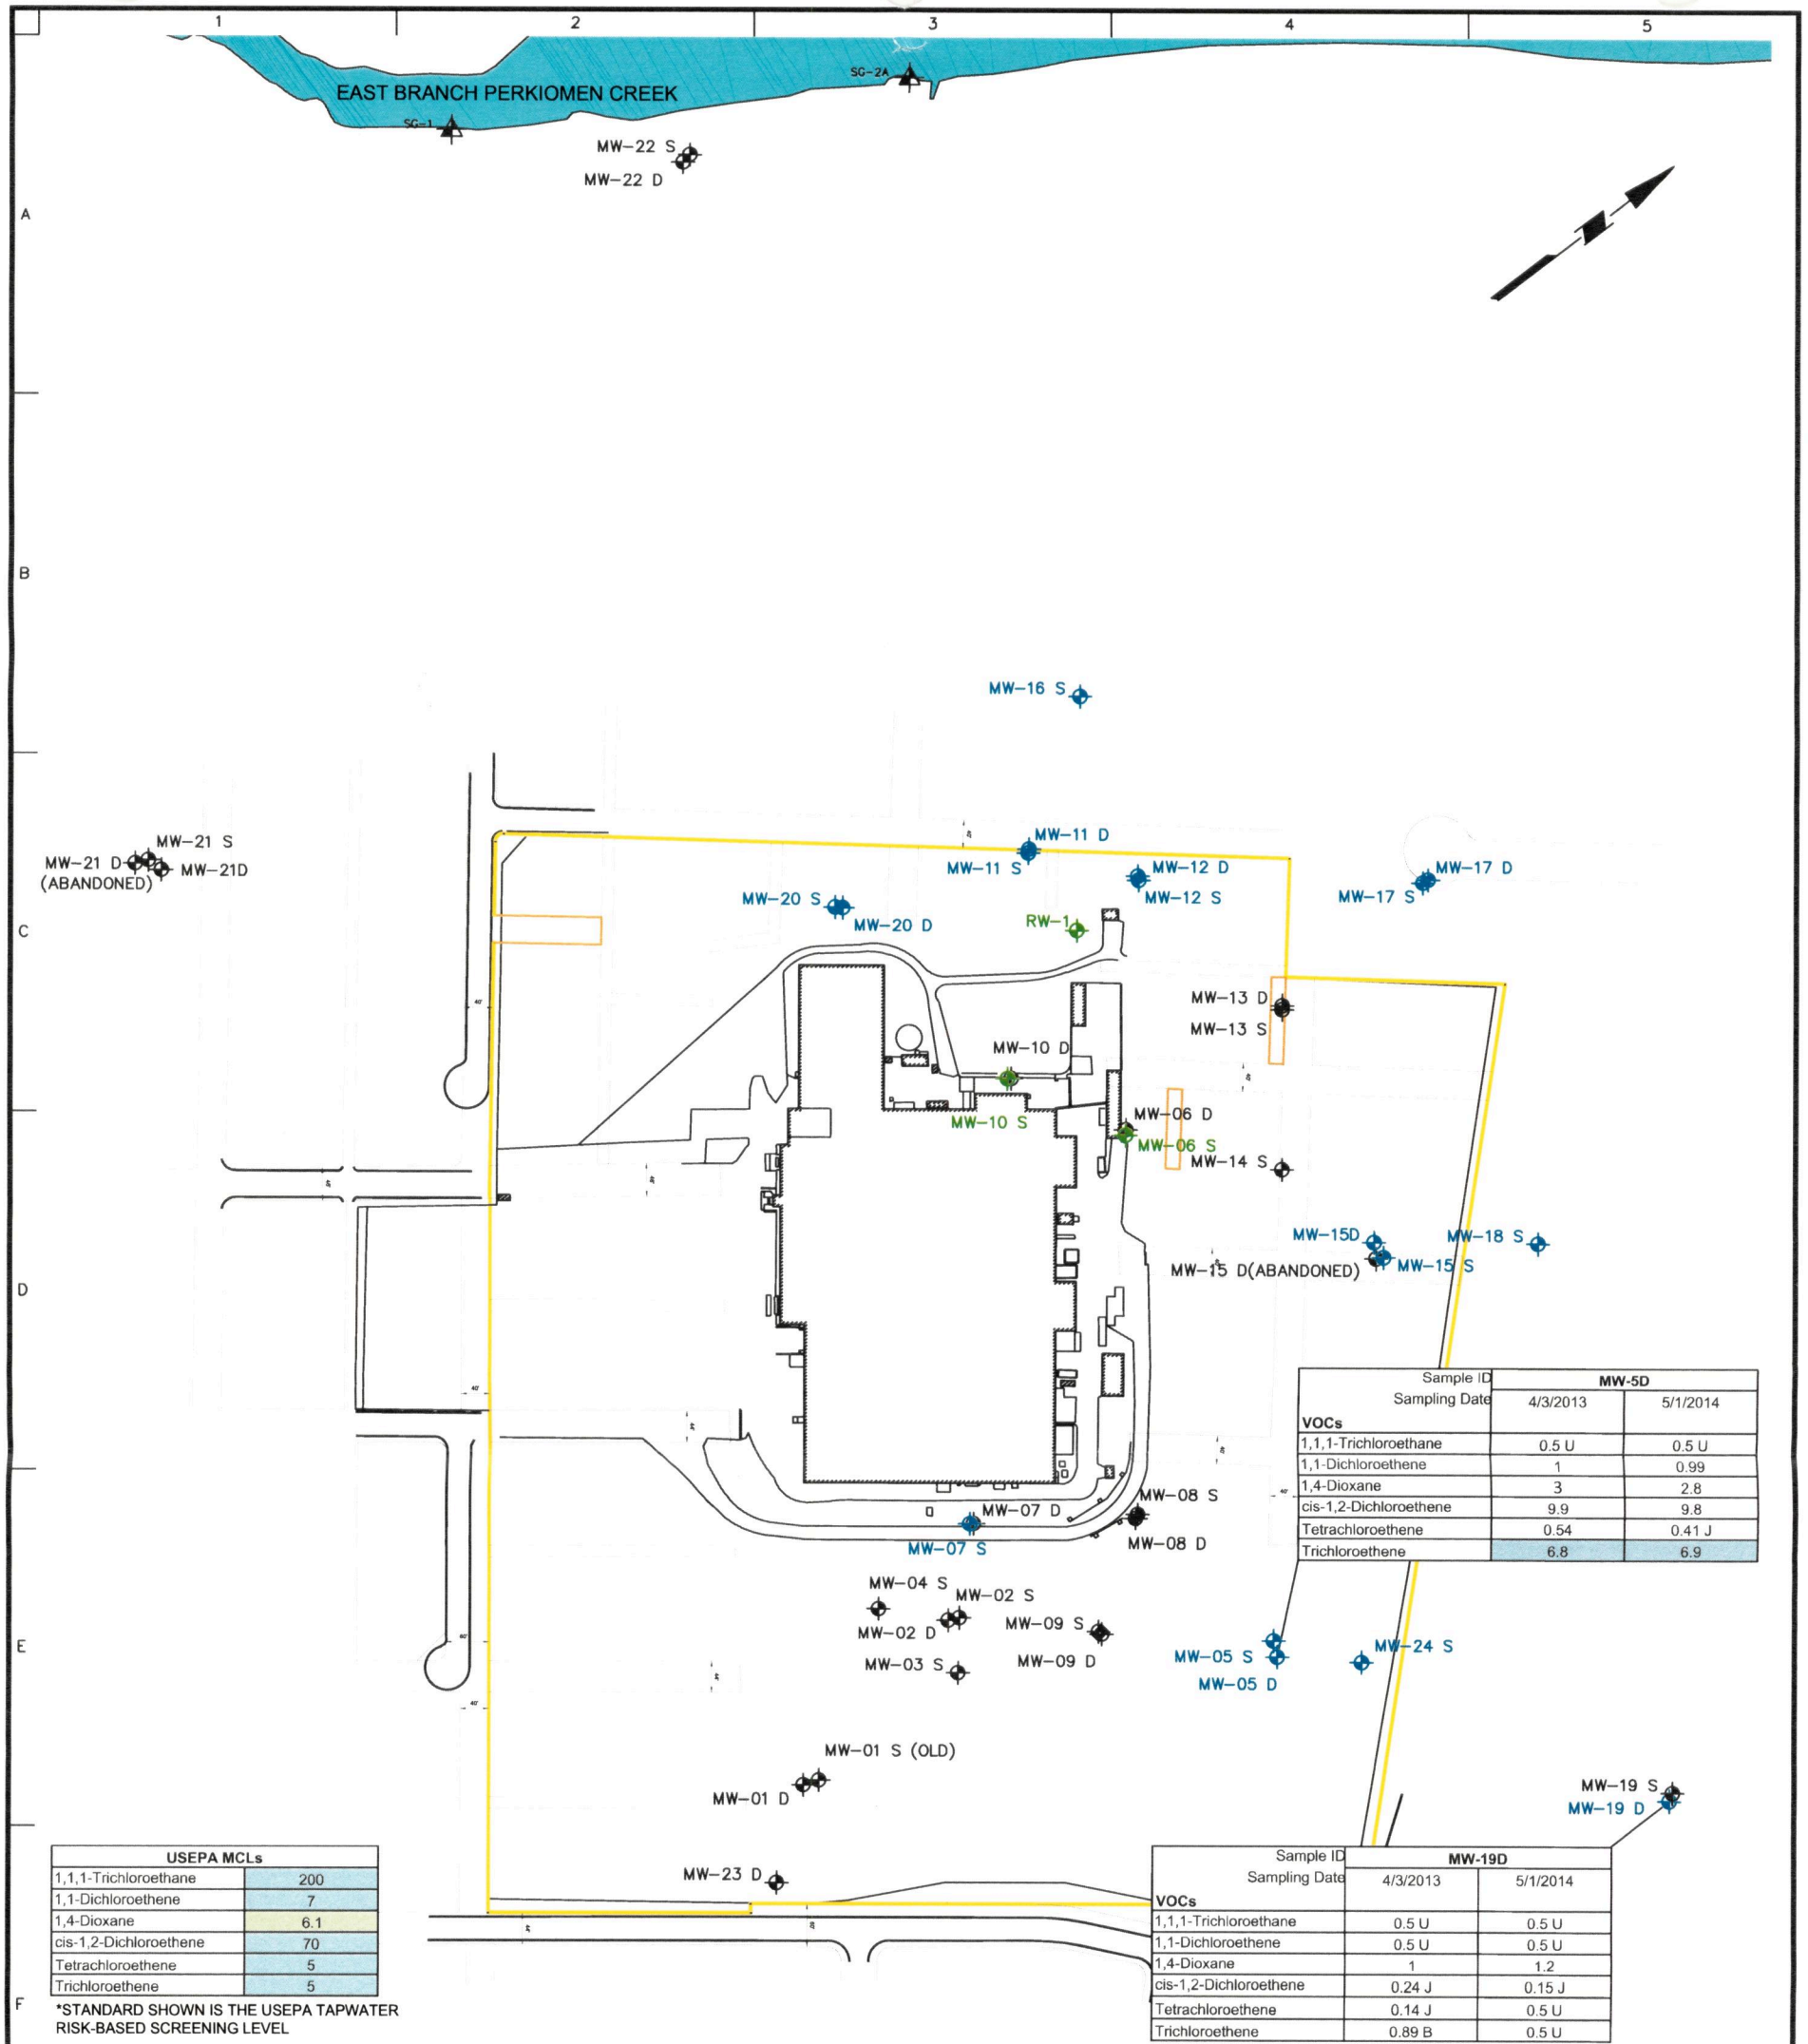

LANGAN
Stone Manor Corporate Center, 2700 Kelly Road, Suite 200
Warrington, PA 18976
T: 215.491.6500 F: 215.491.6501 www.langan.com
Langan Engineering, Environmental, Surveying and
Landscape Architecture, D.P.C.
Langan Engineering and Environmental Services, Inc.
Langan International LLC
Collectively known as Langan

Project

**AMETEK U.S.
GAUGE DIVISION**
SELLERSVILLE

BUCKS COUNTY PENNSYLVANIA

Drawing Title

**DEEP AQUIFER (SOUTH)
GROUNDWATER
ANALYTICAL RESULTS
VOC AND 1,4-DIOXANE
2013 TO 2014**

Project No.
220051801

Date
6/26/14

Scale
1"=250'

Drawn By
MMK

Submission Date
X


Drawing No.

5

Sheet 5 of 9

Filename: \\Langan.com\data\PH\data8\220051801\Cadd Data - 220051801\2D-DesignFiles\Environmental\2014 Annual Report\GW Analytical Figures.dwg Date: 7/14/2014 Time: 12:54 User: vbeneski Style Table: Langan.stb Layout: Deep South

© 2013 Langan

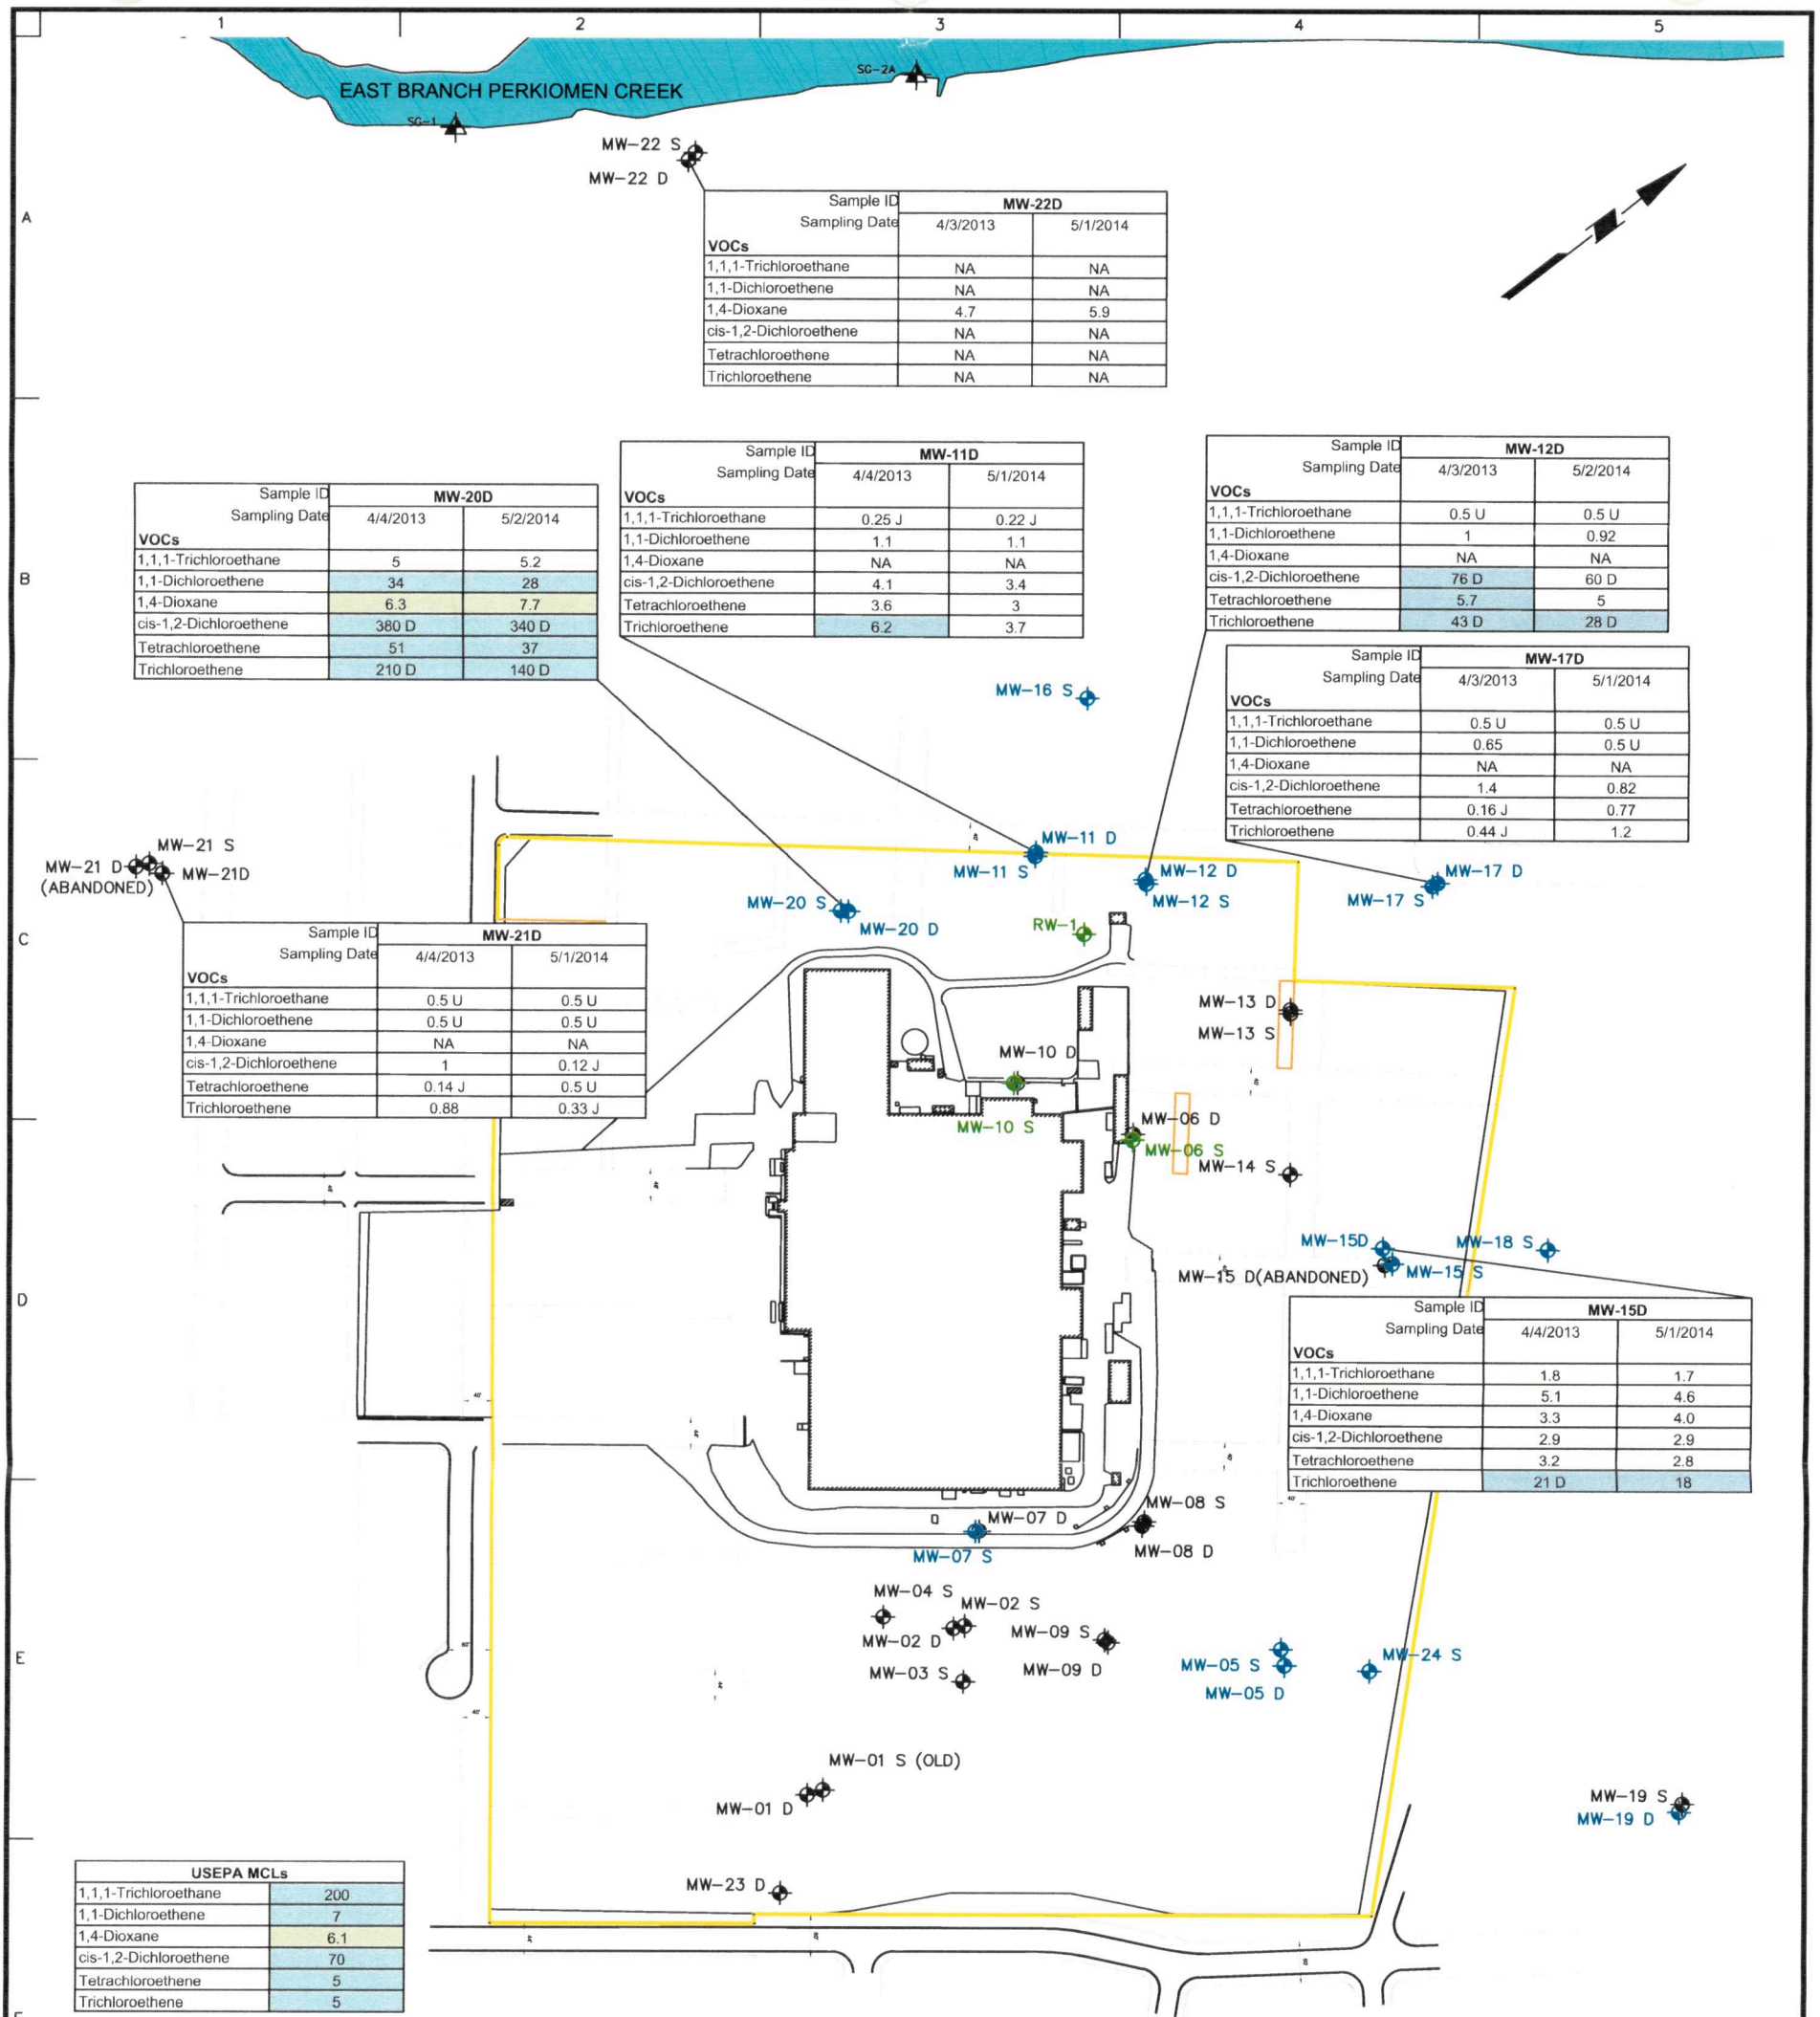

LEGEND


- TI BOUNDARY
- PROPERTY NOT OWNED BY AMETEK
- MW-1 MONITORING WELLS THAT COMPRISE THE TI BOUNDARY MONITORING WELL NETWORK.
- MW-23D SITE MONITORING WELL LOCATION
- RW-1 IRM PUMPING WELL LOCATION

DATA QUALIFIERS:

- U = THE COMPOUND WAS ANALYZED FOR, BUT WAS NOT DETECTED AT OR ABOVE THE METHOD DETECTION LIMIT.
- D = THE REPORTED VALUE IS TAKEN FROM THE ANALYSIS OF A DILUTED SAMPLE.
- J = THE COMPOUND WAS POSITIVELY IDENTIFIED; THE ASSOCIATED NUMERICAL VALUE IS THE APPROXIMATE CONCENTRATION OF THE ANALYTE IN THE SAMPLE.
- B = THE COMPOUND WAS FOUND IN THE BLANK AND SAMPLE.

NOTES:

- 1) GROUNDWATER CONSTITUENTS THAT EXCEEDED USEPA'S MAXIMUM CONTAMINANT LEVELS ARE HIGHLIGHTED IN BLUE. 1,4-DIOXANE LEVELS THAT EXCEED THE USEPA'S TAPWATER RISK-BASED SCREENING LEVELS OF 6.1µg/L ARE HIGHLIGHTED IN GREEN.
- 2) NEW SITE WIDE BASEMAP SURVEY WAS SURVEYED BY TAYLOR WISEMAN & TAYLOR ON NOVEMBER 2011.
- 3) 10% OF LABORATORY PROVIDED ANALYTICAL DATA HAS BEEN INDEPENDENTLY VALIDATED IN ACCORDANCE WITH PROJECT PROTOCOL.
- 4) NA = NOT ANALYZED (WELLS ANALYZED PER CMI MONITORING PROGRAM)
- 5) ALL CONCENTRATIONS ARE IN MICROGRAMS/LITER (µg/L).
- 6) THE MW-6D (FORMER GROUNDWATER RECOVERY WELL) GROUNDWATER RECOVERY PUMP HAS BEEN DISCONNECTED, NO SAMPLE CAN BE COLLECTED.
- 7) TI MONITORING WELLS DISPLAYED IN BLUE COMPRISE THE TI BOUNDARY MONITORING WELL NETWORK. MW-21S AND MW-21D (NEW) LIE BEYOND THE TI BOUNDARY, HOWEVER, THEY WILL BE MONITORED UNTIL MCLs ARE OBTAINED. IN ADDITION, MW-22D WILL BE MONITORED FOR 1,4-DIOXANE (PER REVISED WORK PLAN)
- 8) THE MAIN BUILDING AND OUT STRUCTURES WERE DEMOLISHED IN JUNE 2012.
- 9) PBA 10 WAS DEACTIVATED ON MARCH 23, 2007 AND REACTIVATED ON SEPT 9, 2012.

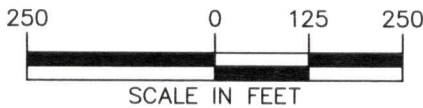

SCALE IN FEET

LANGAN

Stone Manor Corporate Center, 2700 Kelly Road, Suite 200
Warrington, PA 18976
T: 215.491.6500 F: 215.491.6501 www.langan.com

Langan Engineering, Environmental, Surveying and
Landscape Architecture, D.P.C.
Langan Engineering and Environmental Services, Inc.
Langan International LLC

Collectively known as Langan

Project

**AMETEK U.S.
GAUGE DIVISION
SELLERSVILLE**

BUCKS COUNTY

PENNSYLVANIA

Drawing Title

**DEEP AQUIFER (NORTH)
GROUNDWATER
ANALYTICAL RESULTS
VOC AND 1,4-DIOXANE
2013 TO 2014**

Project No.

220051801

Date

6/26/14

Scale

1"=250'

Drawn By

MMK


Submission Date

X

Drawing No.


6

Sheet 6 of 9

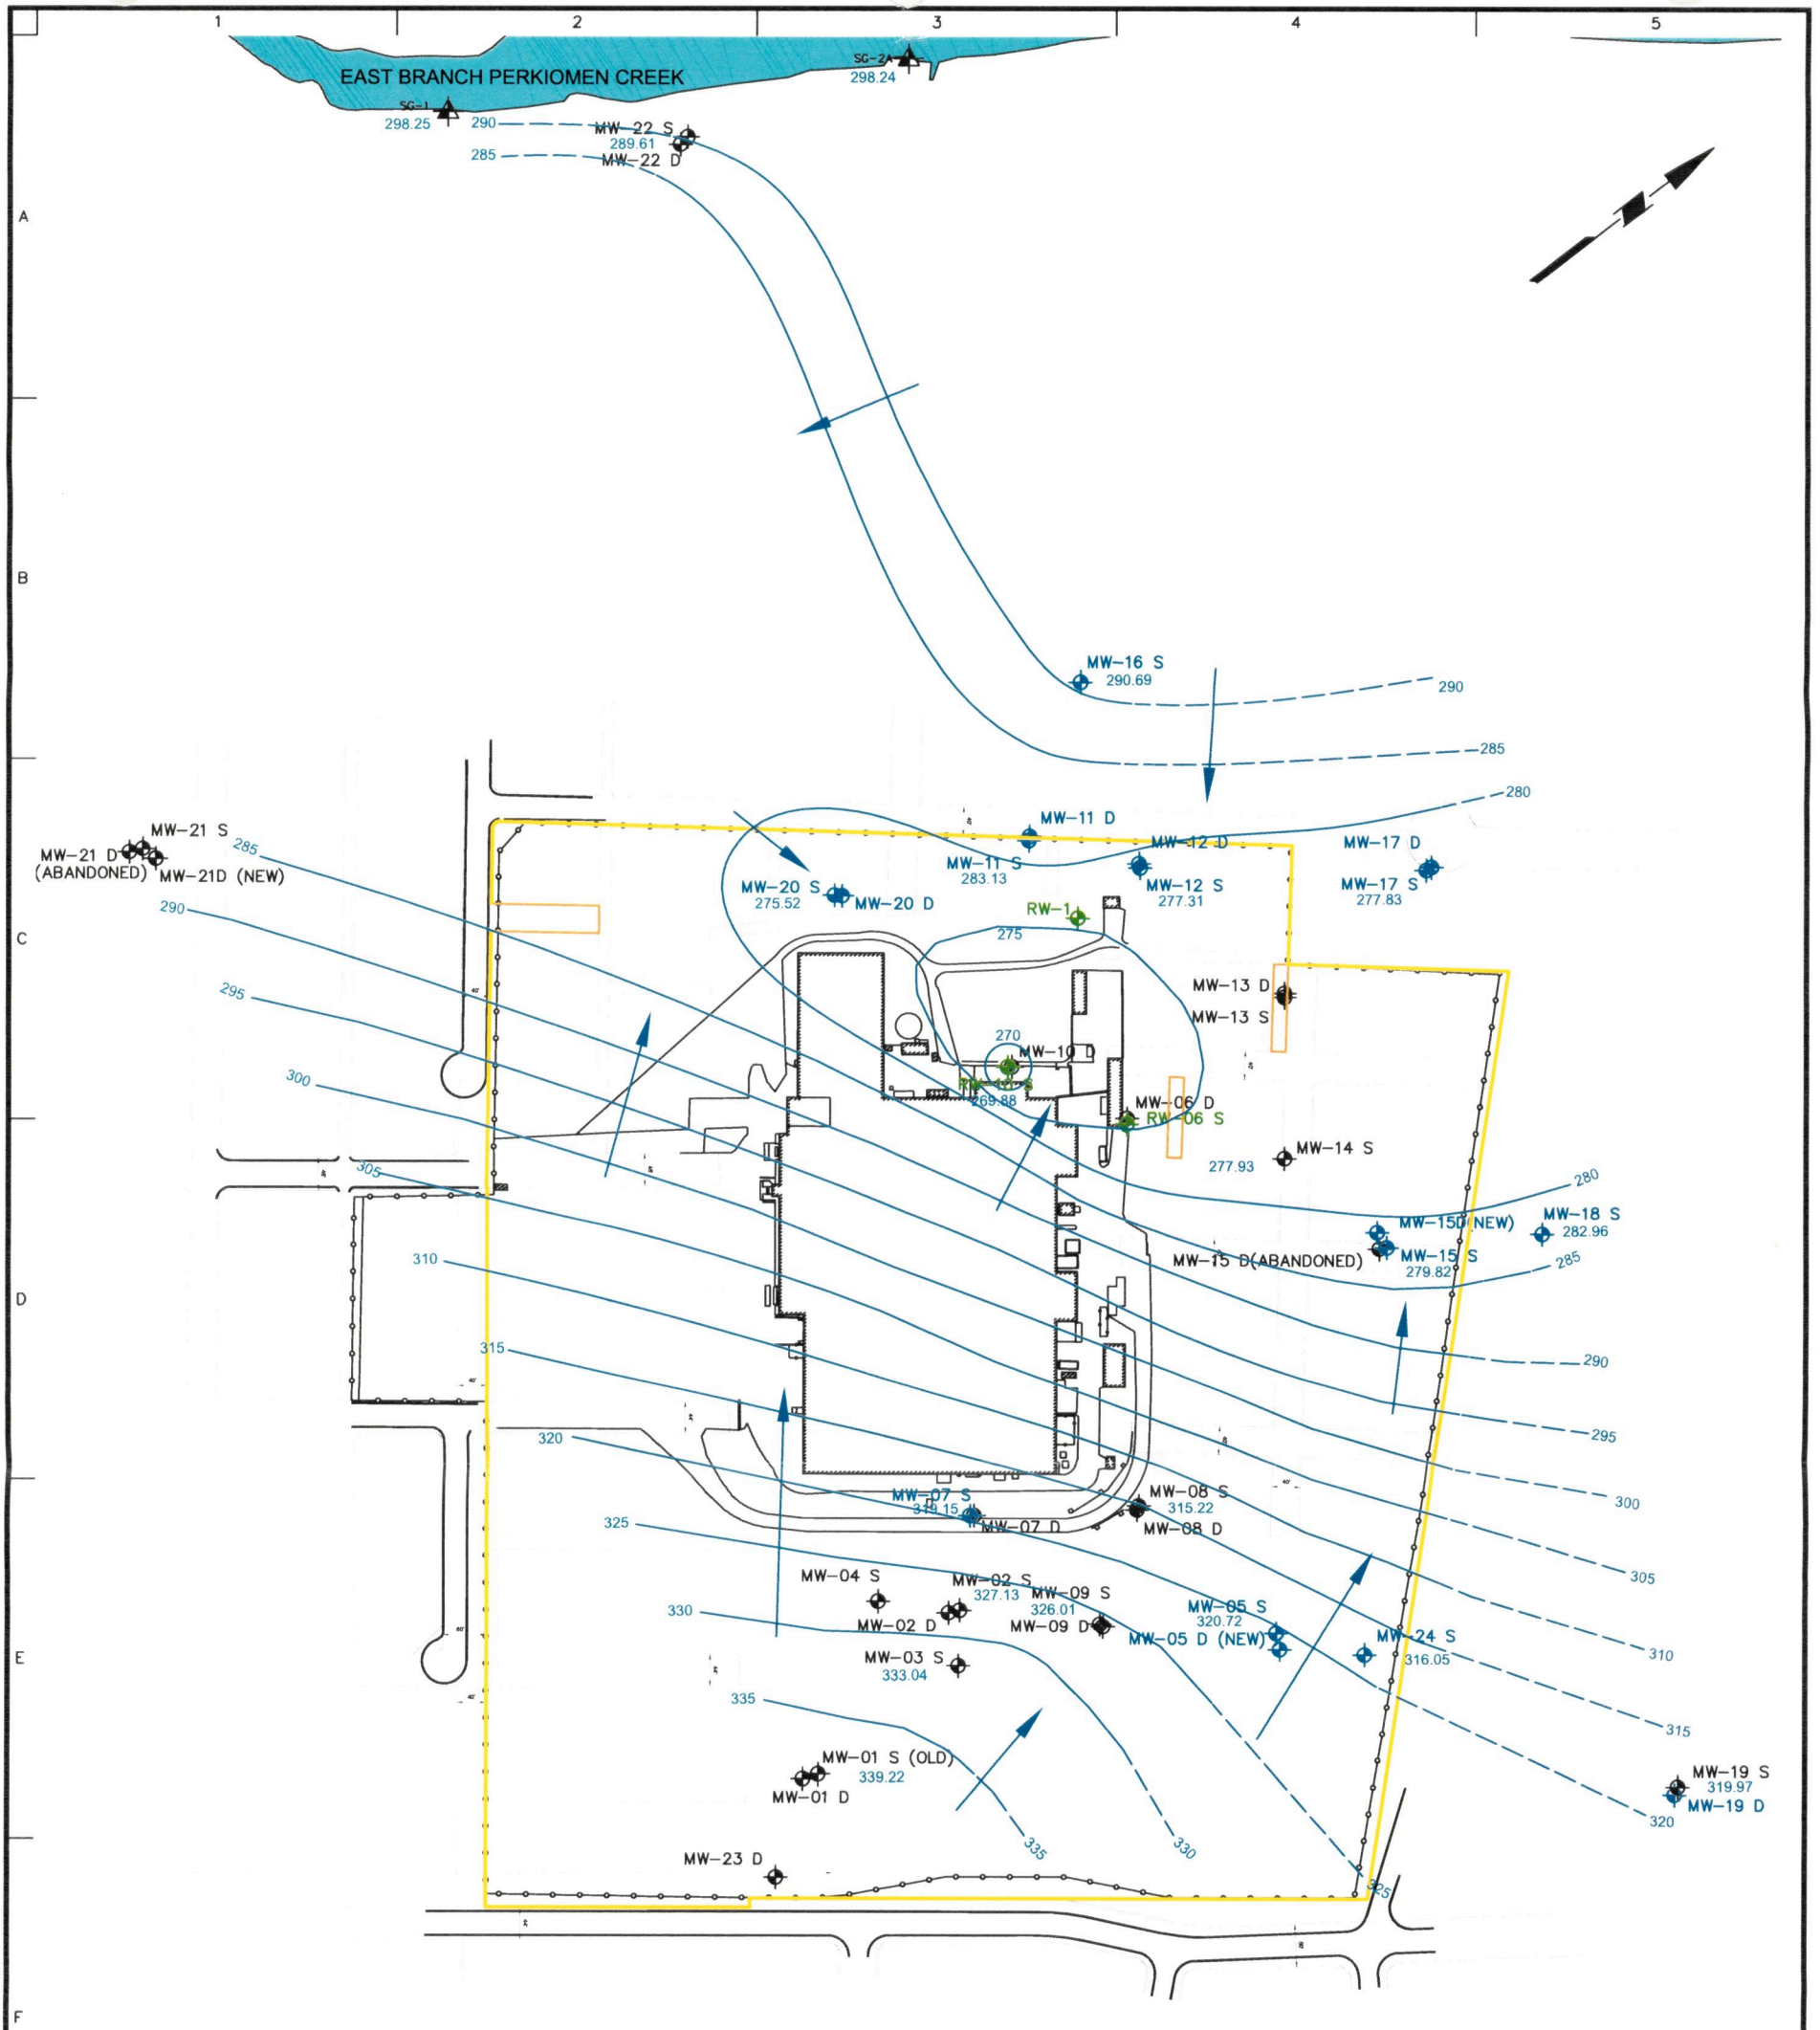


- NOTES:**
- 1) NEW SITE WIDE BASEMAP SURVEY WAS SURVEYED BY TAYLOR WISEMAN & TAYLOR ON NOVEMBER 2011.
 - 2) SOME MODIFICATIONS HAVE BEEN MADE TO THE GROUNDWATER MODELING SYSTEM VERSION 5.0 OUTPUT (CONTOURS) BASED ON SITE GEOLOGY AND KNOWLEDGE OF SITE CONDITIONS.
 - 3) RW-1, MW-6S, & MW-10S ARE ACTIVE IRM SYSTEM GROUNDWATER RECOVERY WELLS.
 - 4) MW-1S(NEW), MW-5D, AND MW-14D WERE ABANDONED AND REPLACEMENT WELL MW-5D(NEW) WAS INSTALLED, APRIL 2005 AS RECOMMENDED IN THE FINAL LETTER REPORT ON THE ADDITIONAL ENVIRONMENTAL INVESTIGATION ACTIVITIES CONDUCTED IN JULY 2004.
 - 5) WELLS MW-21D (NEW) AND MW-15D (NEW) WERE INSTALLED TO REPLACE MW-15D AND MW-21D IN FEBRUARY 2006. MW-21D AND MW-15D APPEAR TO HAVE BEEN OVER GROUTED DURING THE APRIL 2005 PARTIAL ABANDONMENT EFFORT AND WERE NOT IN HYDRAULIC COMMUNICATION WITH THE AQUIFER. MW-15D AND MW-21D WERE ABANDONED ON FEBRUARY 9, 2006 AND APRIL 13, 2006, RESPECTIVELY.
 - 6) TI MONITORING WELLS DISPLAYED IN BLUE COMPRISE THE TI BOUNDARY MONITORING WELL NETWORK. MW-21S AND MW-21D (NEW) LIE BEYOND THE TI BOUNDARY, HOWEVER, THEY WILL BE MONITORED UNTIL MCLs ARE OBTAINED. IN ADDITION, MW-22D WILL BE MONITORED FOR 1,4-DIOXANE (PER REVISED WORK PLAN).
 - 7) THE MAIN BUILDING AND OUT STRUCTURES WERE DEMOLISHED IN 2012.
 - 8) PBA 10 WAS DEACTIVATED ON MARCH 23, 2007 AND REACTIVATED ON SEPT 9, 2012.

- LEGEND**
- INTERPRETED GROUNDWATER CONTOUR (FEET ABOVE MEAN SEA LEVEL)
 - INFERRED GROUNDWATER CONTOUR (FEET ABOVE MEAN SEA LEVEL)
 - GROUNDWATER FLOW DIRECTION
 - TI BOUNDARY
 - PROPERTY NOT OWNED BY AMETEK
 - MONITORING WELLS THAT COMPRISE THE TI BOUNDARY MONITORING WELL NETWORK.
 - SITE MONITORING WELL LOCATION
 - IRM PUMPING WELL LOCATION

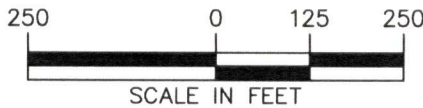

LANGAN Stone Manor Corporate Center, 2700 Kelly Road, Suite 200 Warrington, PA 18976 T: 215.491.6500 F: 215.491.6501 www.langan.com Langan Engineering, Environmental, Surveying and Landscape Architecture, D.P.C. Langan Engineering and Environmental Services, Inc. Langan International LLC Collectively known as Langan	Project AMETEK U.S. GAUGE DIVISION SELLERSVILLE BUCKS COUNTY PENNSYLVANIA	Drawing Title SHALLOW AQUIFER GROUNDWATER CONTOURS APRIL 2014	Project No. 220051801	7
			Date 7/11/14	
			Scale 1"=250'	
			Drawn By TY	
			Submission Date X	Sheet 7 of 9

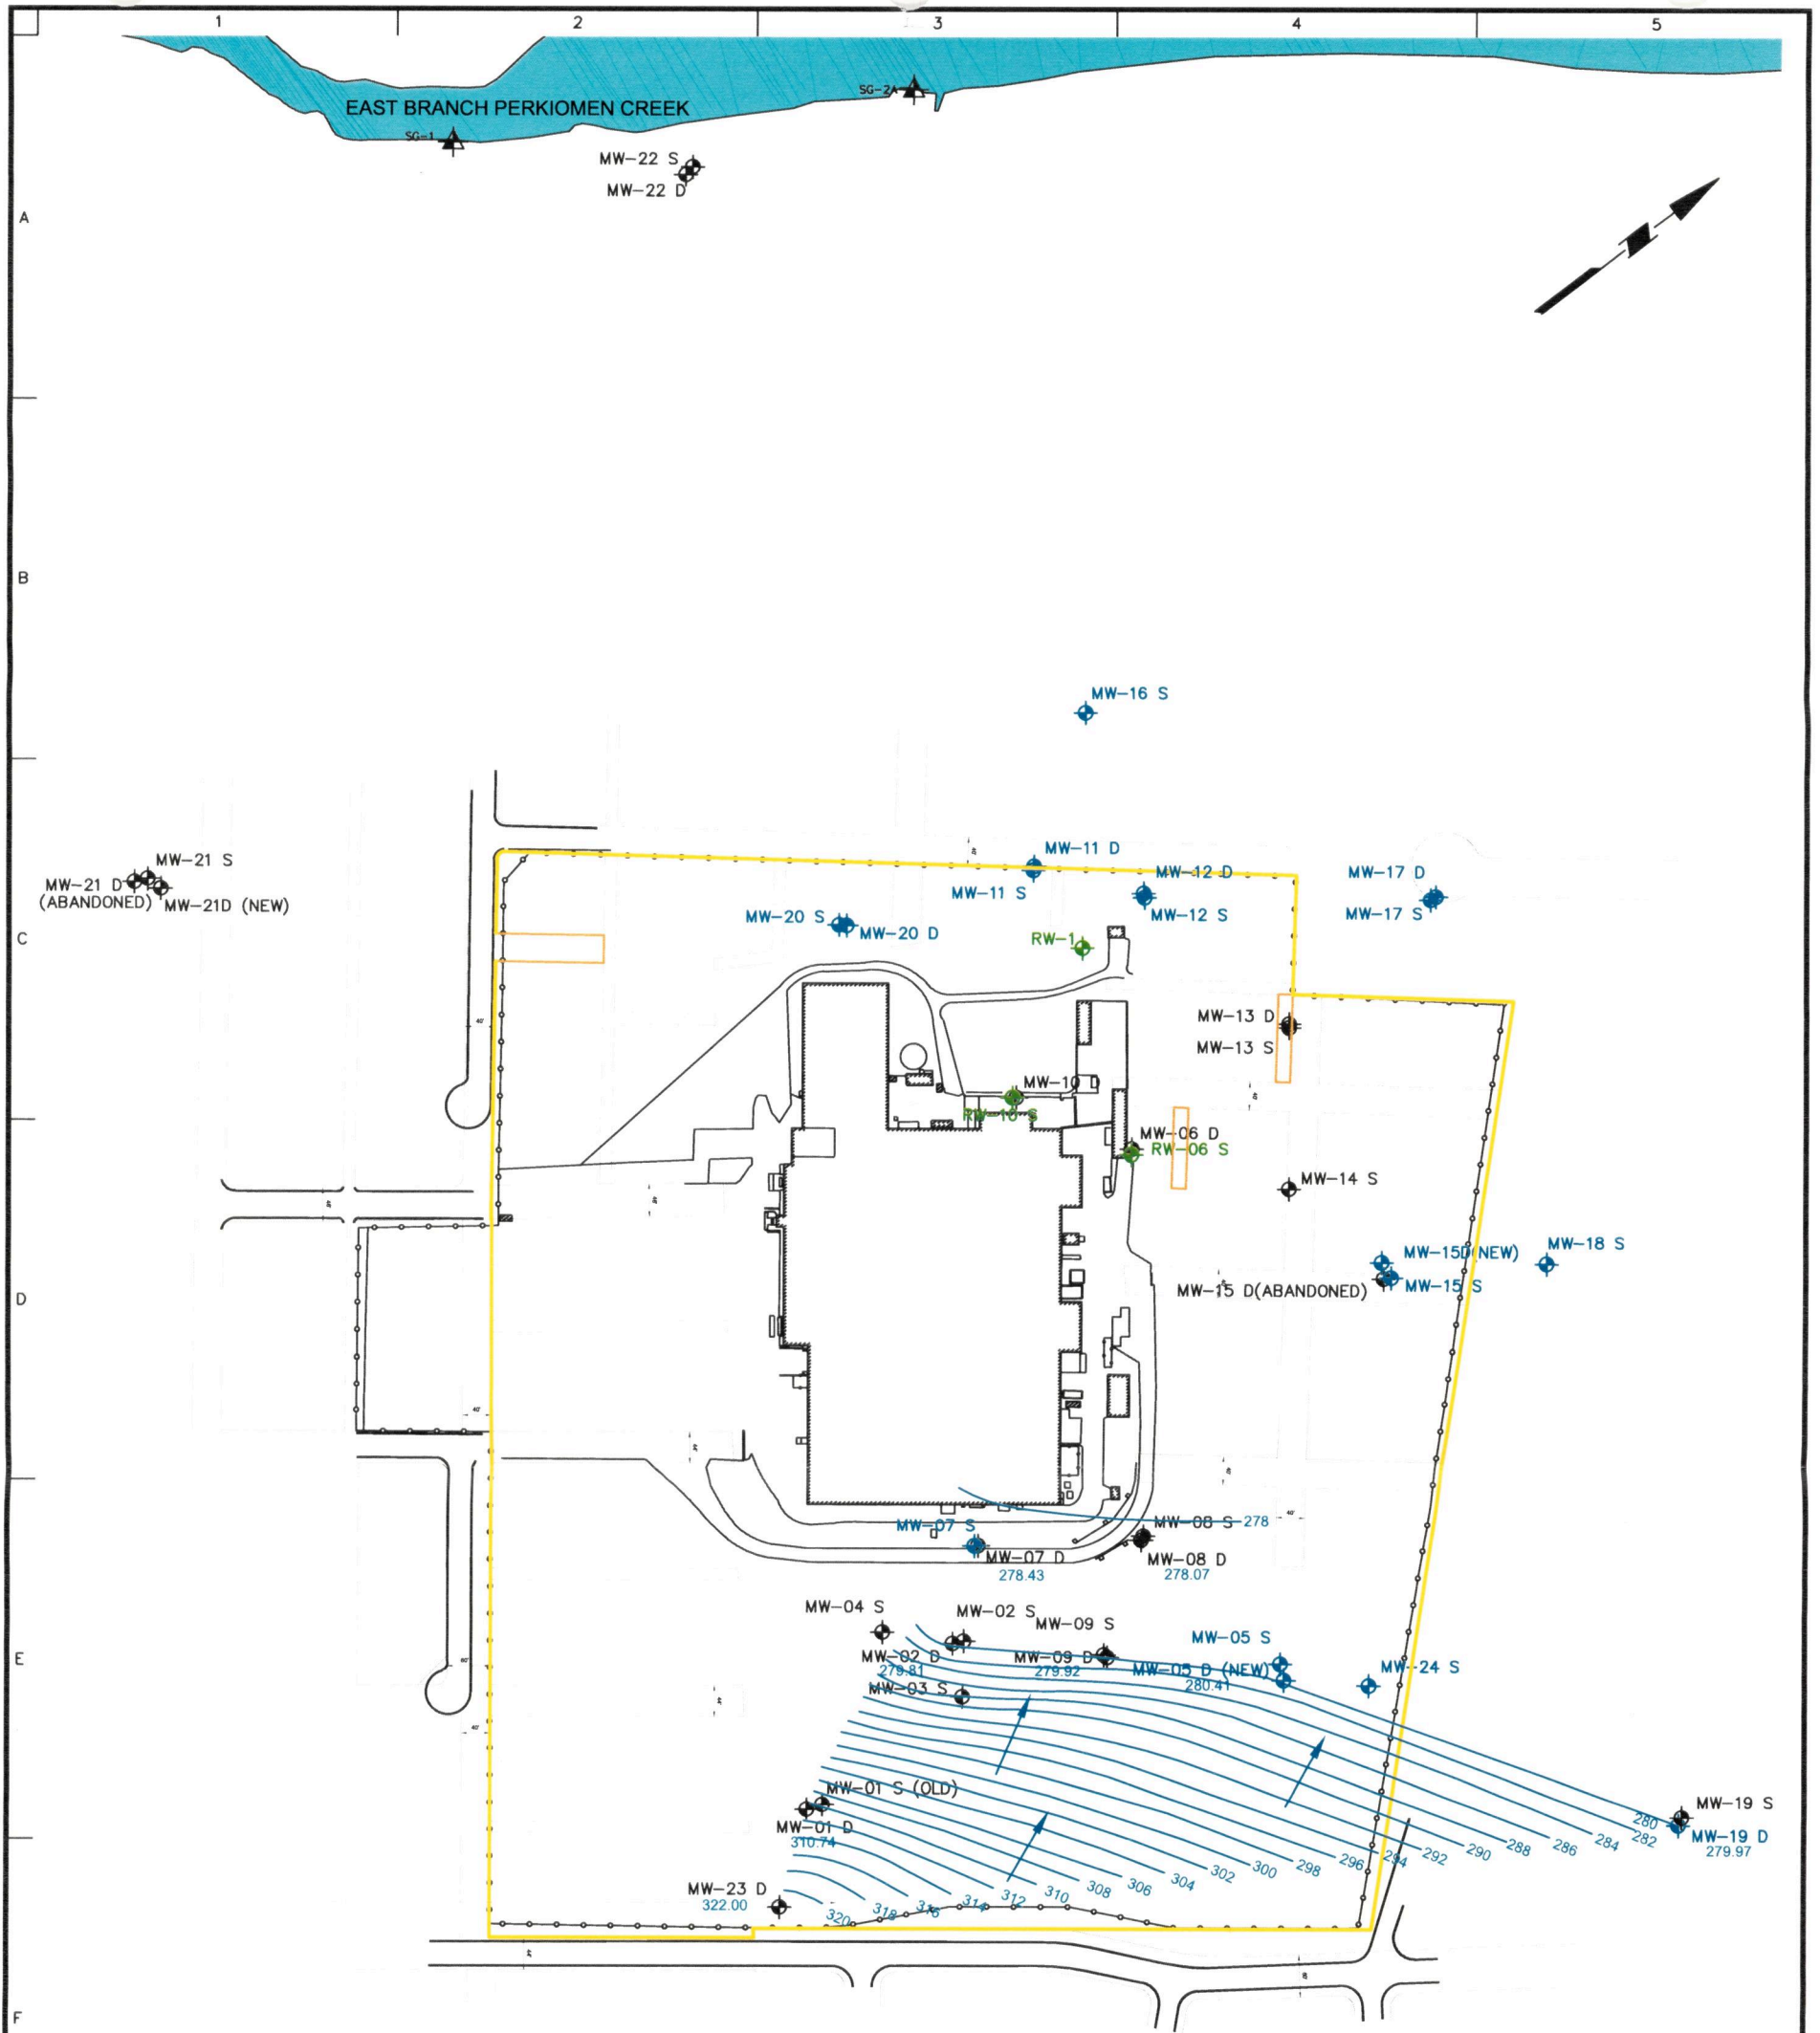

NOTES:

1) NEW SITE WIDE BASEMAP SURVEY WAS SURVEYED BY TAYLOR WISEMAN & TAYLOR ON NOVEMBER 2011.

2) SOME MODIFICATIONS HAVE BEEN MADE TO THE GROUNDWATER MODELING SYSTEM VERSION 5.0 OUTPUT (CONTOURS) BASED ON SITE GEOLOGY AND KNOWLEDGE OF SITE CONDITIONS.

3) RW-1, MW-6S, & MW-10S ARE ACTIVE IRM SYSTEM GROUNDWATER RECOVERY WELLS.

4) MW-1S(NEW), MW-5D, AND MW-14D WERE ABANDONED AND REPLACEMENT WELL MW-5D(NEW) WAS INSTALLED, APRIL 2005 AS RECOMMENDED IN THE FINAL LETTER REPORT ON THE ADDITIONAL ENVIRONMENTAL INVESTIGATION ACTIVITIES CONDUCTED IN JULY 2004.

5) WELLS MW-21D (NEW) AND MW-15D (NEW) WERE INSTALLED TO REPLACE MW-15D AND MW-21D IN FEBRUARY 2006. MW-21D AND MW-15D APPEAR TO HAVE BEEN OVER GROUTED DURING THE APRIL 2005 PARTIAL ABANDONMENT EFFORT AND WERE NOT IN HYDRAULIC COMMUNICATION WITH THE AQUIFER. MW-15D AND MW-21D WERE ABANDONED ON FEBRUARY 9, 2006 AND APRIL 13, 2006, RESPECTIVELY.


6) TI MONITORING WELLS DISPLAYED IN BLUE COMPRISE THE TI BOUNDARY MONITORING WELL NETWORK. MW-21S AND MW-21D (NEW) LIE BEYOND THE TI BOUNDARY, HOWEVER, THEY WILL BE MONITORED UNTIL MCLs ARE OBTAINED. IN ADDITION, MW-22D WILL BE MONITORED FOR 1,4-DIOXANE (REVISED WORK PLAN).

7) THE MAIN BUILDING AND OUT STRUCTURES WERE DEMOLISHED IN 2012.

8) PBA 10 WAS DEACTIVATED ON MARCH 23, 2007 AND REACTIVATED ON SEPT 9, 2012.

LEGEND

- INTERPRETED GROUNDWATER CONTOUR (FEET ABOVE MEAN SEA LEVEL)
- INFERRED GROUNDWATER CONTOUR (FEET ABOVE MEAN SEA LEVEL)
- GROUNDWATER FLOW DIRECTION
- TI BOUNDARY
- PROPERTY NOT OWNED BY AMETEK
- MONITORING WELLS THAT COMPRISE THE TI BOUNDARY MONITORING WELL NETWORK.
- SITE MONITORING WELL LOCATION
- IRM PUMPING WELL LOCATION

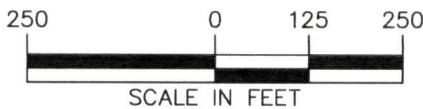


LANGAN
Stone Manor Corporate Center, 2700 Kelly Road, Suite 200
Warrington, PA 18976
T: 215.491.6500 F: 215.491.6501 www.langan.com
Langan Engineering, Environmental, Surveying and
Landscape Architecture, D.P.C.
Langan Engineering and Environmental Services, Inc.
Langan International LLC
Collectively known as Langan

Project
**AMETEK U.S.
GAUGE DIVISION
SELLERSVILLE**
BUCKS COUNTY PENNSYLVANIA

Drawing Title
**DEEP AQUIFER (SOUTH)
GROUNDWATER
CONTOURS
APRIL 2014**

Project No.
220051801
Date
7/11/14
Scale
1"=250'
Drawn By
TY
Submission Date
X

Drawing No.
8
Sheet 8 of 9

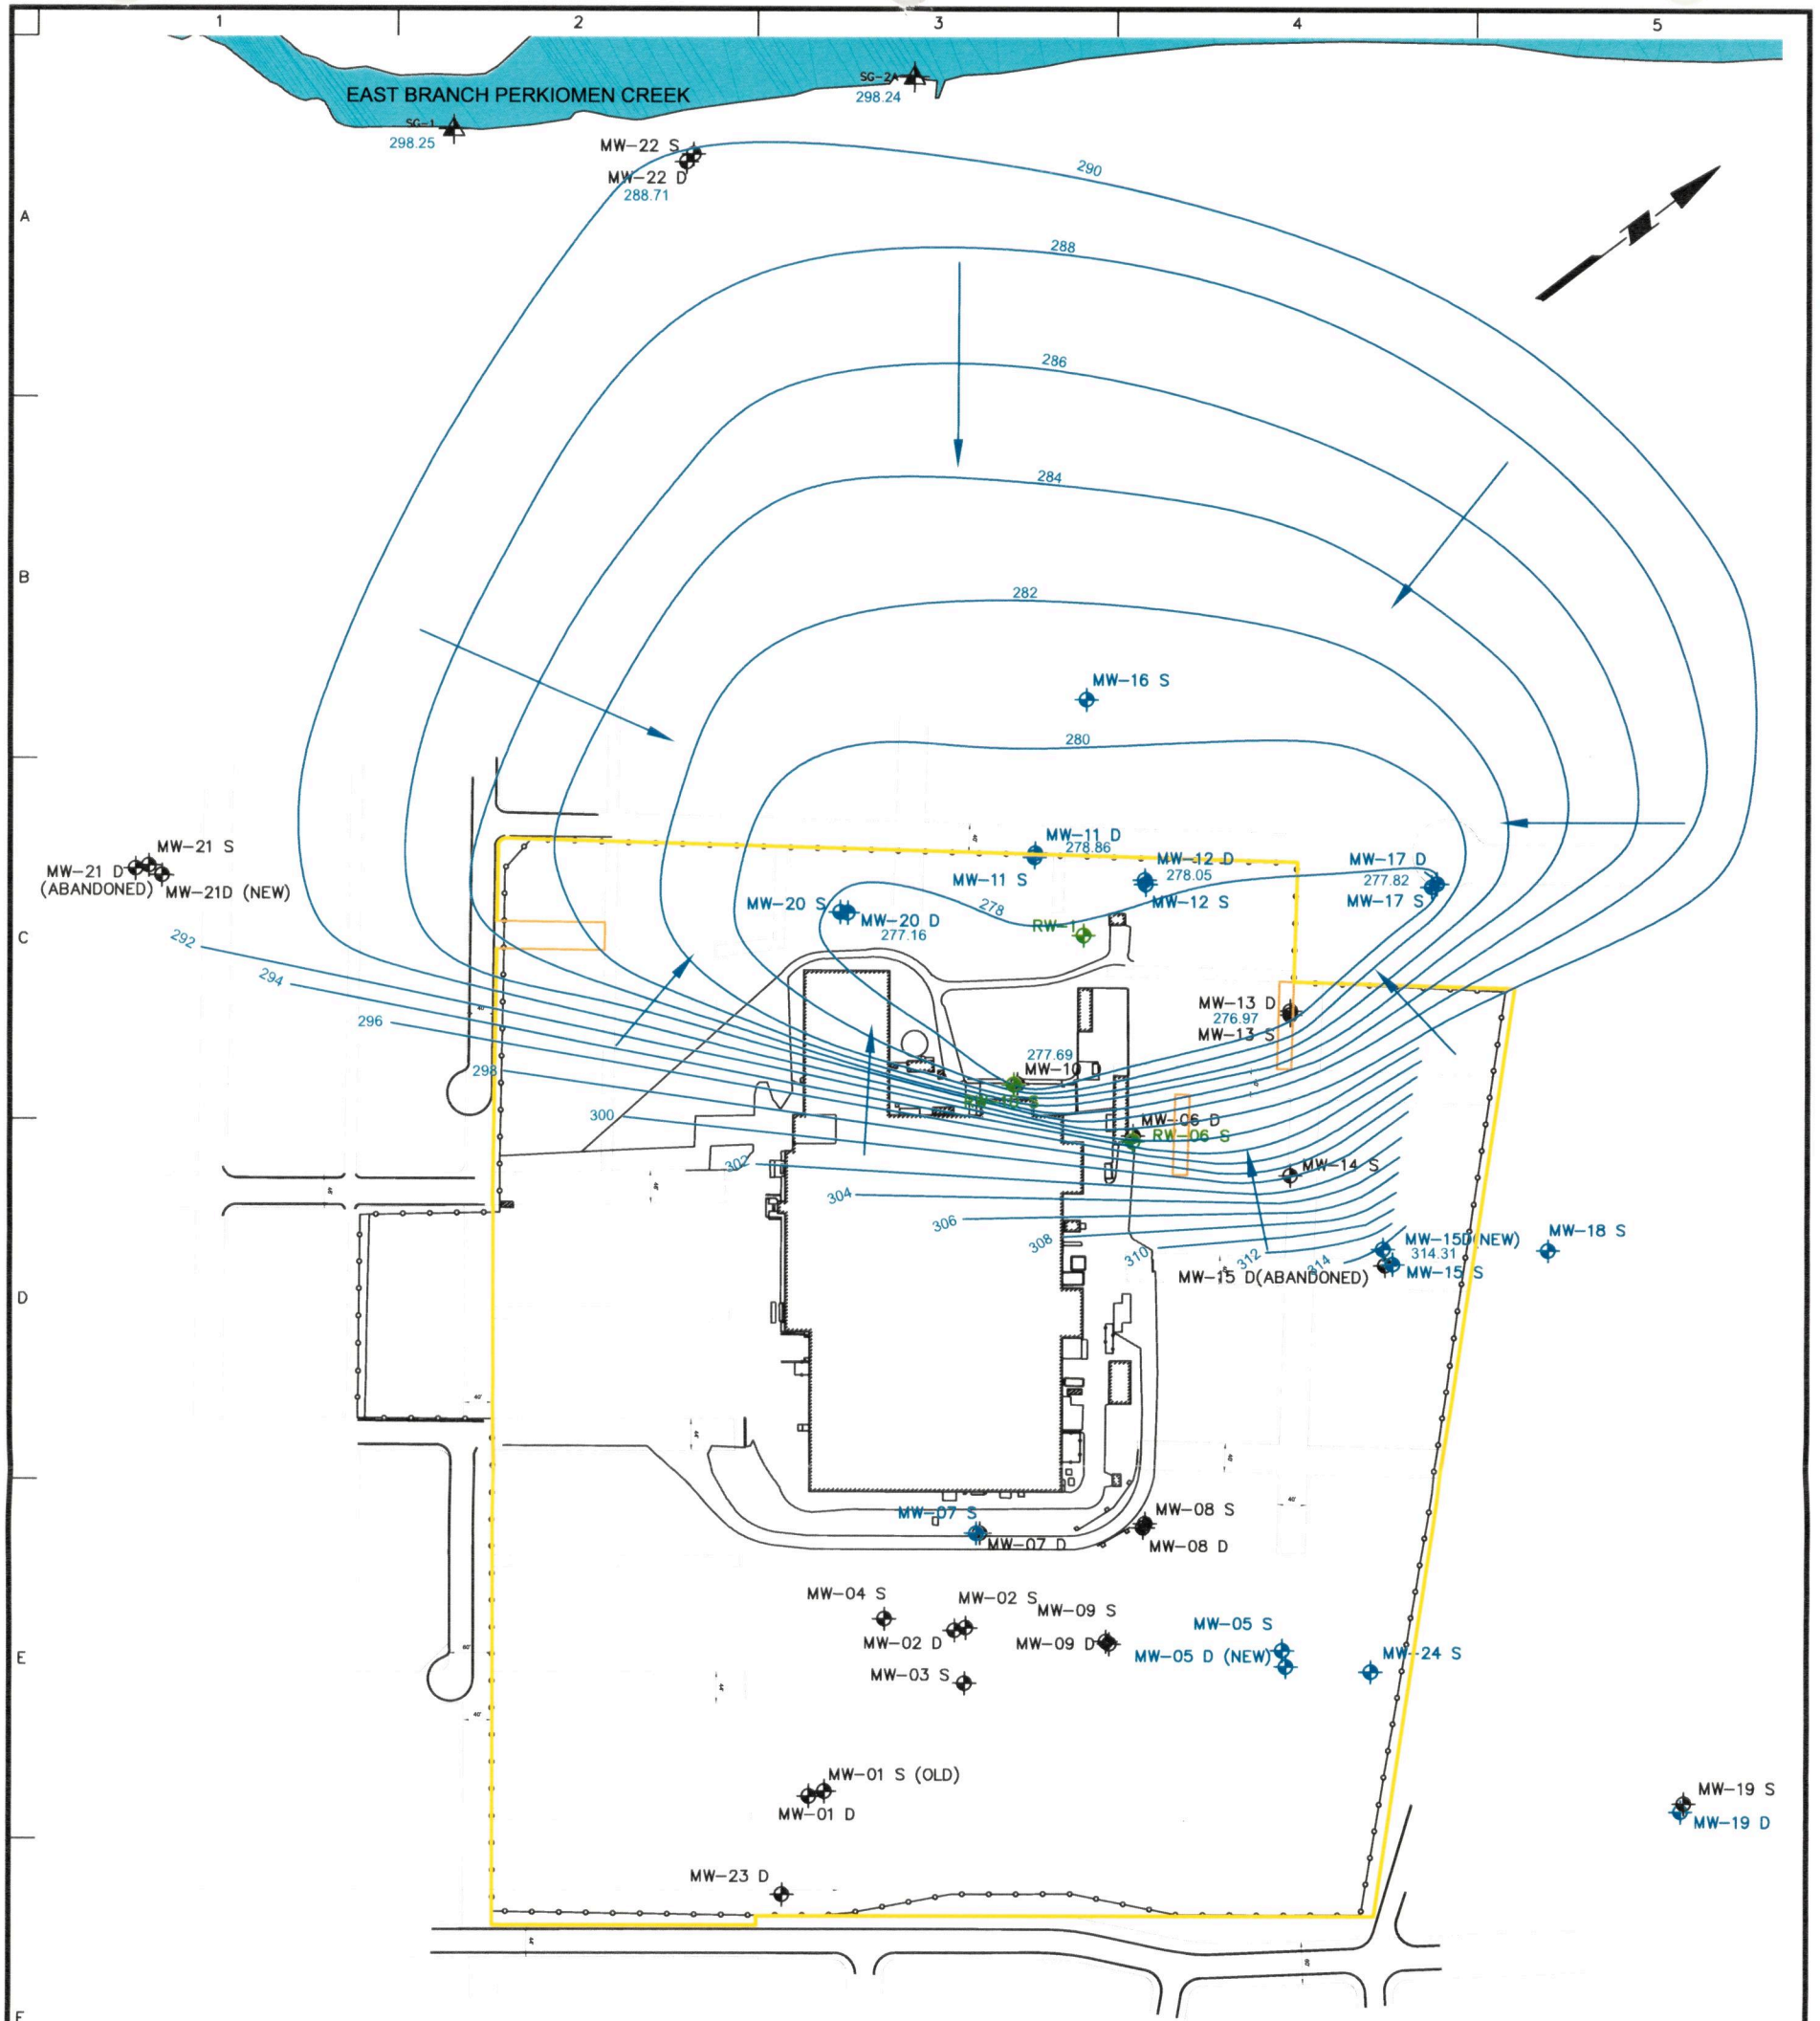


NOTES:

- 1) NEW SITE WIDE BASEMAP SURVEY WAS SURVEYED BY TAYLOR WISEMAN & TAYLOR ON NOVEMBER 2011.
- 2) SOME MODIFICATIONS HAVE BEEN MADE TO THE GROUNDWATER MODELING SYSTEM VERSION 5.0 OUTPUT (CONTOURS) BASED ON SITE GEOLOGY AND KNOWLEDGE OF SITE CONDITIONS.
- 3) RW-1, MW-6S, & MW-10S ARE ACTIVE IRM SYSTEM GROUNDWATER RECOVERY WELLS.
- 4) MW-1S(NEW), MW-5D, AND MW-14D WERE ABANDONED AND REPLACEMENT WELL MW-5D(NEW) WAS INSTALLED, APRIL 2005 AS RECOMMENDED IN THE FINAL LETTER REPORT ON THE ADDITIONAL ENVIRONMENTAL INVESTIGATION ACTIVITIES CONDUCTED IN JULY 2004.
- 5) WELLS MW-21D (NEW) AND MW-15D (NEW) WERE INSTALLED TO REPLACE MW-15D AND MW-21D IN FEBRUARY 2006. MW-21D AND MW-15D APPEAR TO HAVE BEEN OVER GROUTED DURING THE APRIL 2005 PARTIAL ABANDONMENT EFFORT AND WERE NOT IN HYDRAULIC COMMUNICATION WITH THE AQUIFER. MW-15D AND MW-21D WERE ABANDONED ON FEBRUARY 9, 2006 AND APRIL 13, 2006, RESPECTIVELY.
- 6) TI MONITORING WELLS DISPLAYED IN BLUE COMPRISE THE TI BOUNDARY MONITORING WELL NETWORK. MW-21S AND MW-21D (NEW) LIE BEYOND THE TI BOUNDARY, HOWEVER, THEY WILL BE MONITORED UNTIL MCLs ARE OBTAINED. IN ADDITION, MW-22D WILL BE MONITORED FOR 1,4-DIOXANE (PER REVISED WORK PLAN).
- 7) THE MAIN BUILDING AND OUT STRUCTURES WERE DEMOLISHED IN 2012.
- 8) PBA 10 WAS DEACTIVATED ON MARCH 23, 2007 AND REACTIVATED ON SEPT 9, 2012.

LEGEND

- INTERPRETED GROUNDWATER CONTOUR (FEET ABOVE MEAN SEA LEVEL)
- GROUNDWATER FLOW DIRECTION
- TI BOUNDARY
- PROPERTY NOT OWNED BY AMETEK
- MW-1 SITE MONITORING WELL LOCATION
- MW-23D SITE MONITORING WELL LOCATION
- RW-1 IRM PUMPING WELL LOCATION

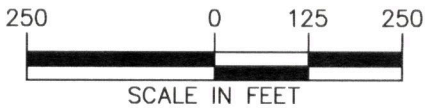

SCALE IN FEET

LANGAN

Stone Manor Corporate Center, 2700 Kelly Road, Suite 200
Warrington, PA 18976
T: 215.491.6500 F: 215.491.6501 www.langan.com

Langan Engineering, Environmental, Surveying and
Landscape Architecture, D.P.C.
Langan Engineering and Environmental Services, Inc.
Langan International LLC

Collectively known as Langan

Project

**AMETEK U.S.
GAUGE DIVISION
SELLERSVILLE**

BUCKS COUNTY

PENNSYLVANIA

Drawing Title

**DEEP AQUIFER (NORTH)
GROUNDWATER
CONTOURS
APRIL 2014**

Project No.
220051801

Date
7/14/14

Scale
1"=250'

Drawn By
TY

Submission Date
X

Drawing No.

9

Sheet 9 of 9